



Operation Instructions

Cavity Melt Pressure Sensors (Transmitter)
PT180 series



Shanghai Ziasiot Technology Co., Ltd.

 www.ziasiot.com  info@ziasiot.com  400-821-0137





CONTENTS

01	Product Introduction	01
02	Product Model and Specifications	01
03	Transportation and Storage	01
04	Product Installation Hole	02
05	Product Installation	03
06	Product Disassembly	03
07	Housing Fixation	04
08	Wiring and Cabling	04
09	Product Calibration	05
10	Electrical Connection	06
11	Fault Analysis	08

01 Product introduction

Cavity Melt Pressure Sensors (Transmitters) for applications in confined spaces
Cavity type melt pressure sensor (transmitter) is an instrument to measure melt pressure in high temperature area (referred to as sensor and transmitter), digital-analog circuit design, please follow the instructions below for storage and operation can ensure the maximum service life of the product.

The product complies with the national JJG860-2015 "Pressure Sensor (static) Certification Regulations" and JJG882-2019 "Pressure Transmitter Certification Regulations".

02 Product Model and Specifications

Product Model: PT180

2.1 High temperature melt pressure sensor

Definition: Products with an output signal of 3.33m V/V or other m V/V.

Measuring range: (0-10)MPa, (0-20)MPa, (0-35)MPa, (0-50)MPa,
(0-70)MPa, (0-100)MPa, (0-140)MPa, (0-200)MPa

2.2 High temperature melt pressure transmitter

Definition: The output signal is (4-20) mA, 0-10Vdc, 0-5Vdc.

Measuring range: (0-3.5)MPa, (0-5)MPa, (0-7)MPa, (0-10)MPa,
(0-20)MPa, (0-35)MPa, (0-50)MPa, (0-70)MPa,
(0-100)MPa, (0-140)MPa, (0-200)MPa

Performance Parameter	High Temperature Melt Pressure Sensors	High Temperature Melt Pressure Transmitter	
Output Signal	3.33mV/V	(4-20)m A Two-wire system	3-wire(0-10)Vdc, 3-wire (0-5)Vdc
Supply Voltage	(6-12)Vdc (10 Vdc recommended)	(10-36)Vdc	(12-36)Vdc
Load resistance (Ω)		<(Supply voltage-10)/0.02	>10k
		Calibration signal: 80% F.S.	
Basic Error (%)	±0.5%(level 0.5), ±0.25%(level 0.25)(expressed as a percentage of the full scale output value)		
	Repeatability shall not be greater than the absolute value of the basic error, and the return difference shall not be greater than the absolute value of the basic error.		

03 Transportation and Storage

3.1 The product is normally packaged individually and when stored, please carefully repackage the packaging it originally came with.


3.2 At the front thread of the rigid rod, the induction diaphragm is protected by a protective cap, which should be tightened at any time during storage and only opened when using the installation. It is strictly prohibited to press the diaphragm with sharp materials.

3.3 Long-term storage needs to meet the following conditions:


- ① Ambient temperature: $-20\sim 85^{\circ}\text{C}$, relative humidity: $0\%\sim 100\%\text{R.H}$
- ② Not exposed to rain or affected by water seepage/leakage.
- ③ Vibration and shock kept to a minimum.

04 Product Installation Hole

Before installing the product, make sure that the mounting holes are machined to the correct size and that the holes are free of burrs.

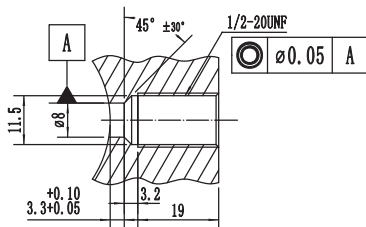

Correct Installation Mode

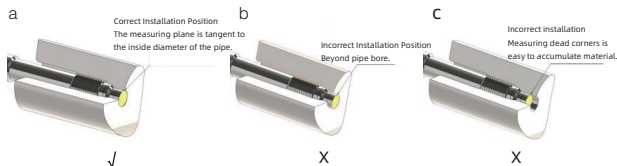

05 Product Installation

5.1 Before installing the product, please check whether the technical parameters on the nameplate are correct or not, mainly including mounting threads, pressure range, output signal, power supply requirements. The main parameters include mounting thread, pressure range, output signal and power supply requirements.

5.2 Ensure that the mounting holes are drilled to the correct dimensions. If the product is installed in a previously used mounting hole, professional cleaning tools should be used to ensure that the mounting hole is completely clean and free of any plastic residue.

5.3 Remove the protective cap from the front of the product.

5.4. Apply high-temperature anti-seize grease to the threaded surfaces of the product to prevent thread seizure. If you need to install a gasket when sealing the flat surface, please put the high temperature anti-seize grease on the surface. If you need to install a sealing gasket for flat sealing, please apply high-temperature anti-seize grease on the sealing gasket and stick the gasket on the product.

5.5 Place the product smoothly into the mounting hole, first manually, and then use a wrench to tighten it on the hexagon. If the product is to be mounted in a previously used mounting hole, it is recommended that the product be mounted under conditions of heating to the melting point of the plastic.

The recommended maximum mounting torque is 40 Nm.

06 Product disassembly


6.1 Disassembly must be done under heated conditions (plastic melting point). When disassembling the sensor, make sure that the diaphragm is not contact pressure. The force for dismounting the sensor must be applied only to the shaft (hexagon) and not to the sensor head. Do not apply any force to the sensor head. If the mounting holes need to be blocked, seal them with a plug of the same mechanical size.

6.2 After disassembling the product, the diaphragm, sealing surfaces and threads must be quickly wiped clean with a soft cloth.

6.2 After disassembling the product, the diaphragm, sealing surfaces and threads must be quickly wiped clean with a soft cloth.

07 Product disassembly

Use our professional mounting bracket to fix the product, the fixing position should avoid vibration and installation in a strong magnetic environment, and should not be exposed to rain or water seepage/leakage, the temperature should not exceed 85°C.

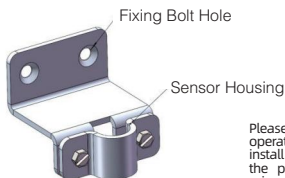

Please strictly follow the operation instructions to install and disassemble the product, caused by misoperation damage, we does not assume the quality responsibility.

08 Wiring and Cabling

8.1, the cable should be used with a shielded cable, heat-resistant temperature of not less than 105 °C, each core line connecting terminal should be heat-shrinkable The shielded cable should be connected with the plug-in metal, and special care should be taken when welding the cable, otherwise it may lead to signal transmission error or damage the product. Otherwise, it may cause signal transmission error or damage the product. Please refer to "Electrical Connection" for wiring definition.

8.2. If you use our welded cables, you only need to connect them according to the definition of "Electrical Connection".

8.3 Signal cable should be wired separately through the wiring channel, strong and weak power should be wired separately, please avoid high temperature when wiring. The recommended ambient temperature is below 85°C.

8.4. It is strictly prohibited to plug the cable into the electrical connection of the high-temperature melt pressure sensing/high-temperature melt pressure transmitter, The cable should not be pulled out of the wiring.

8.5 After the cable is connected, connect it to the terminal block of the signal receiving end according to our electrical connection definition. If there is any extra If there is any extra wire core, please wrap each wire core individually with insulating tape.

09 Product Calibration

After the product is installed and connected to the measuring instrument and powered on, and in the absence of any pressure, the system temperature has reached the operating temperature 30min to 60min, the product is calibrated. Calibration method:

- High temperature melt pressure sensor (mV/V signal output): Please clear and calibrate the instrument on the display instrument, refer to the zeroing method and calibration method of the display instrument.
- High temperature melt pressure transmitter:


There are two zeroing methods for this series: external magnetic zeroing and remote short-circuit zeroing, and one zeroing method can be used at will. The maximum adjustment ratio is 30% of the full-scale output signal.

1. Short-circuit clearing adjustment mode: refer to "electrical connection" to define the cable core of short-circuit clearing, short-circuit after 3 to 5 seconds to disconnect, you can clear. After zeroing, ensure that the insulation of the two wires shorting the zeroing is separated from each other to avoid short-wiring when the wires are not insulated or when there is pressure, resulting in inaccurate pressure measurement.
2. If the shell has "Ⓢ" this mark, you can use our special magnetic pen, the magnet is aligned with this mark and close to 3~5 seconds later in the removal, you can clear. If there is no magnet, it can also be operated by the short-circuit clearing method in the above "1".

10 Electrical Connection

Pressure output signal wiring definition:


Electrical Wiring Configuration
4-Wire Transmitter
0...20/33.333mV

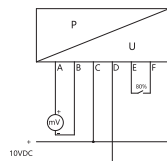

Connector type:PT02A-10-6P.

PIN	Function	Wire Color
A	Signal+	Red
B	Signal-	Black
C	Power+	White
D	Power-	Green
E	80%+	Blue
F	80%-	Orange


Electrical Wiring Configuration
3-Wire Transmitter
4...20mA

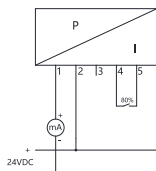

Connector type:PT02A-10-6P.

PIN	Function	Wire Color
A	Signal+	Red
B	Signal-	Black
C	Power+	White
D	Short-circuit clearing+	Green
E	80%+	Blue
F	Short-circuit clearing-/80%-	Orange

Electrical Wiring Configuration
4-Wire Transmitter(shorting to zero)
0...5V/10V

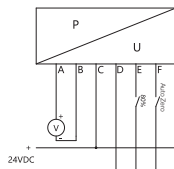

Connector type:PT02A-10-6P.


PIN	Function	Wire Color
A	Signal+	Red
B	Signal-	Black
C	Power+	White
D	Power-/80% short-circuit clearing	Green
E	80%+	Blue
F	short-circuit clearing+	Orange

*Pin 3 and 4 Connected internally

Electrical Wiring Configuration

4-Wire Sensor

0...33.333mV/V

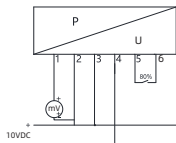


PIN	Function	Wire Color
1	Signal+	Red
2	Signal-	Black
3	Power+	White
4	Power-	Green
5	80%+	Blue
6	80%-	Orange

Electrical Wiring Configuration

4-Wire Sensor

0...33.333mV

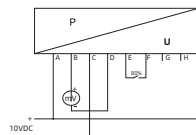

PIN	Function	Wire Color
A	Power+	Red
B	Signal+	Black
C	Power-	White
D	Signal-	Green
E	80%+	Blue
F	80%-	Yellow
G		Grey
H		Brown

11 Fault Analysis

Common faults and troubleshooting methods:

Fault	Reason	Troubleshooting Methods
	1. The hole size problem: the size is small, the concentricity is not enough, and the hole has rough edges. 2. The temperature is more than 400°C.	1. Check the hole size. 2. Check whether the normal operating temperature exceeds 400 °C or whether the temperature exceeds 400 °C during the heating process.
	1. The installation hole caused by burrs. 2. Cold machine installation, solidification caused by materials. 3. External use of hard objects to press the diaphragm.	1. Clear the burrs in the hole. 2. Use special cleaning tools to clear the hard material in the hole and install with the heating machine. 3. Only use fingers to press.
	1. The hole size problem: the diaphragm has extended out of the inner wall of the cylinder. 2. Brush the diaphragm with a hard object.	1. Re-open the hole or add the gasket according to the size. 2. It is strictly prohibited to use hard objects to brush the diaphragm.
	Excessive mounting torque.	Install according to the recommended torque, and try to make the installation force 90° with the screw.
Pressure did not change	Reason	
	1. Check whether the power supply and cable connections are correct.	
	2. Check whether the diaphragm is intact.	
	3. Check whether the output signal is consistent with the input signal of the receiving module.	
Pressure fluctuation	4. Check whether the sensor housing is at a temperature below 80 °C.	
	1. Need to use a shielded cable.	
	2. The equipment should be reliably grounded.	
	3. The shielded wire is connected to the electric control PE wire.	
Pressure measurement is not accurate	1. Check whether the power supply and cable connections are correct.	
	2. Check whether the diaphragm is intact.	
	3. Check whether the output signal is consistent with the input signal of the receiving module.	



Shanghai Ziasiot Technology Co., Ltd.

6th floor, 18th Building, No. 615, Lianying Road, Songjiang District, Shanghai, China.

Tel: 021-37635502 400-821-0137

Fax: 021-37635507

Email: info@ziasiot.com

Web: <http://www.ziasiot.com> (English) <http://www.ziasiot.net> (Chinese)

Zias(Zhejiang) IoT Technology Co., Ltd.

3F305, R&D Building, No. 1237 Jiachuang Road, Xiuzhou District,
Jiaxing City, Zhejiang province, China

Email: zias@ziasiot.com

Tel: 0573-83312892

